

OWNER DISTRICT OF COLUMBIA

FILTER BED RETAINING WALLS, PORTALS & DOORS ARCHITECTURAL RESTORATION MOTES

CRAMINGS.

ALL WORK PROPRINGED LINCORT THIS CONTRACT SHALL COVERLY WITH THE SECRETIFY OF THE INTERPORTS STANDARDS FOR THE TREATMENT OF HISTORIC PROPERTIES AND TECHNICAL COLDICIONES AS A PRINCIPLE OF THE MEMORY APPROXIMATION OF THE SECRETIFICATION OF THE PROPERTIES AND TECHNICAL COLDICIONES AS A PRINCIPLE OF THE MEMORY AND THE CONTRACT OF THE U.S. SCYNMANDET THE WITHOUT OF THE READY ALL WORK PRINCIPLE OF THE WITHOUT AND A POLICIAL WORK PRINCIPLE OF THE WITHOUT AND A POLICIAL WORK PRINCIPLE OF THE WITHOUT AND A POLICIAL WAY WITHOUT AND A POLICIAL PRINCIPLE OF THE WITHOUT AND A POLICIAL PRINCIPLE OF TH

ONY.

REMOVE STAINS, GRAFFITI, AND MINERAL DEPOSITS FROM STRUCTURE. AFTER STAIN REMOVAL,

PERFORM GENERAL, CLEANING OF WALLS, GUIDELINES AND PROCEDURES PROVIDED BY

CONSERVATION SOLUTIONS, INC. SHALL BE FOLLOWED FOR ALL WORK PERFORMED UNDER THIS CONDENSION IN A SOURCE, THE OFFICE OF CONTRACT.

PATCH CRACKS AND SPALLED CONCRETE IN COMPLANCE WITH GSA HISTORIC PRESERVATION.

TECHNICAL PROCEDURE STSORT NATICH COLOR, TEXTLER, AND APPEARANCE OF EXISTING SUPPRICE PROVIDE EPOXY PATCHING NATERIALS PROM ONE OF THE POLLOWING, OR APPROXED.

CARFACE, PROVIDE BYON'S PATCHING MATERIALS FROM ONE OF THE POLICYMEN, OR AMPROVED DISAFFER TO MINE.

SHA CORP.

WHERE APPLICABLE, SPECIFIC ITEMS / AREAS OF RESTORATION ARE KEYNOTED ON THE CRAVINGS.

GENERAL NOTES

LEGEND

ARCHITECTURAL RESTORATION NOTE

DEVELOPER VISION McMILLAN PARTNERS 1508 U Street NW Washingson, DC 20009 Tel. (202) 462-1092

CONSULTANTS
ARCHITECT
PERKINS EASTMAN DC
1250 23rd Street NW
Suite 475
Washingson, DC 20037
Tel. (202) 495-7430

ANDSCAPE ARCHITECT NELSON BYRD WOLTZ 110 East Market Street Charlottesville, VA 22902 Fel. (434) 984-1358 STRUCTURAL ENGINEER

MEP ENGINEER

ETTY & ASSOCIATES NTERNATIONAL, PLLC 135 MacArthur Boulevard NW ionic 220 Vashingson, DC 20016 Jel. (202) 393-1523

LIGHTING DESIGN STROIK LIGHTING DESIG 1470 Waggaman Circle McLean, VA 22101 Tel. (703) 829-0548

HISTORIC PRESERVATION HT TRACERIES 121 5th Street NW Vashington, DC 2000 fel. (202) 393-1199

CIVIL ENGINEER
BOWMAN CONSULTING DC PC
888 17th Street NW
Suite 202
Washington, DC 20005
Tel. (202) 750-2474

SOE/GEOTECHNICAL

ENGINEER GEI CONSULTANTS 1620 I Street NW Suite 800 Washington, DC 20006 Tel. (202) 828-9510

DEMOLITION PERMIT SET







A100

CASE NO.20191

Board of Zoning Adjustmentre WALLS District of Columbia RESTORATION ELEVATIONS, DETAIL & NOTES **EXHIBIT NO.45A1**


2. DRILL FOR & INSERT EPOXY MANUFACTURER INJECTION PORTS, SEAL CRACK ON BOTH SIDES OF WALL RECOMMENDATIONS 1. CLEAN DUST & LOOSE SPALLED CONCRETE W/ A WIRE BRUSH FOLLOWED BY HIGH PRESSURE AIR. 40 NOTE: EPOXY INJECTION GROUT SYSTEM 4. REMOVE INJECTION PORTS & TO BE APPROVED BY ARCHITECT AND GRIND CRACK SEALER SMOOTH ON CONSERVATOR BOTH SIDES OF WALL TAKE CARE NOT TO MAR ADJACENT CONCRETE

SURFACE.

3. INJECT EPOXY CRACK FILLER PER

TYP. CRACK REPAIR DETAIL

NOTE: REPAIR SCOPE INCLUDES ALL CRACKS ON ALL RETAINING WALLS AND PORTALS, INCLUSIVE. PORTAL WALLS VARY IN EXTENT. SOME ARE COMPLETE AND OTHERS PARTIALLY FREE STANDING. VERIFY CONDITION OF THE PORTAL WALLS IN FIELD BEFORE PROCEEDING, SURVEY QUANTITY OF CRACK & PROVIDE UNIT PRICE. CRACK SHOWN IN THIS PARTIAL ELEVATION IS FOR REFERENCE ONLY.

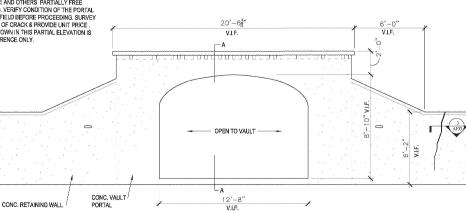

PORTAL SECTION A-A

- ABOVE GRADE SCOPE

BELOW GRADE SCOPE

TYP. PORTAL ELEVATION